

Hardin Park

602 Crescent Street

Town Administrator Todd Smith

Assessment October 23, 2018



LOCATION SUMMARY

A sixty-five acre park that features an Olympic-sized swimming pool with attached bathhouse, 2 playgrounds, fishing pond, 6 covered pavilions, picnic tables, 3 baseball fields, 2 softball fields, 4 tennis courts, outdoor basketball court, a skatepark, and a walking track/trail. The park also houses the maintenance shop and staff. The maintenance area is comprised of two office buildings, 2 garages, and a storage facility.

Responsible for Hardin Park ADA Transition Plan Section

Director Butch Patterson – 423-638-3143 / bpatterson@greenevilletn.gov

Office Manager/Program Supervisor Lisa Scott Fisher – 423-638-3143 / lfisher@greenevilletn.gov

Maintenance Director John Darnell – 423-823-0720 / jdarnell@greenevilletn.gov

ADA Checklist for Existing Facilities

Based on the 2010 ADA Standards for Accessible Design



Project: ADA Assessment Greeneville TN

Building: Hardin Park Kiwanis Pavilion

Location: 602 Crescent drive

Date: July 23, 2018

Surveyors: Dave Wright, Gail Stacy, Caroline Miller

Contact Information: 423-525-5093

Priority 1 – Approach & Entrance

Comments

Possible Solutions

1.1 Is there at least one route from site arrival points (parking, passenger loading zones, public sidewalks and public transportation stops) that does not require the use of stairs?
[See 2010 ADA Standards for Accessible Design – 206.2.1]

Yes

If yes, location of route:

Photo #:

Parking Accessible parking spaces should be identified by size, access aisle and signage.

1.2 If parking is provided for the public, are an adequate number of accessible spaces provided?
[208.2]

Yes

Total #: 8

Accessible #:2

Total Spaces

Accessible Spaces

1 - 25

1

26 - 50

2

51 - 75

3

76 - 100

4

100+ see 2010 Standards 208.2



Photo #:

1.3 Of the accessible spaces, is at least one a van accessible space?*[208.2.4]

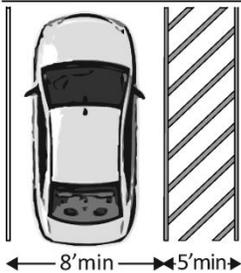
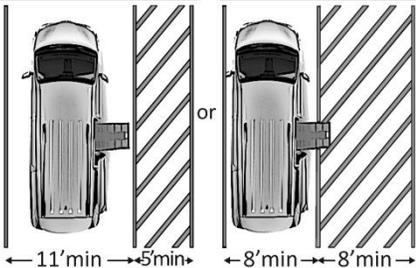
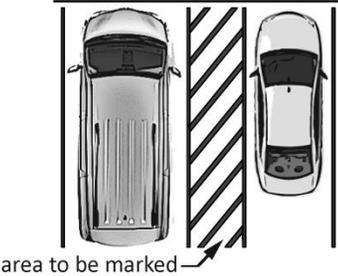
No

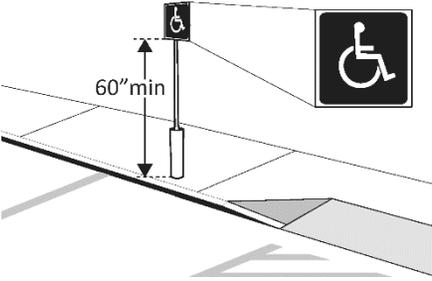
*For every 6 or fraction of 6 parking spaces required by the table above, at least 1 should be a van accessible space.

Photo #:

* If constructed before 3/15/2012, parking is compliant if at least 1 in every 8 accessible spaces is van accessible

- Reconfigure by repainting lines

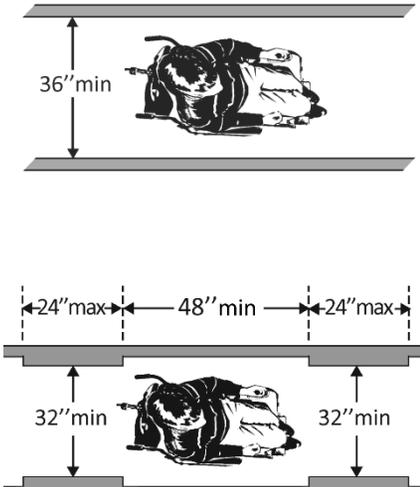
				Budget Year: 2021 Cost: \$250
<p>1.4 Are accessible spaces at least 8 feet wide with an access aisle at least 5 feet wide? [502.2, 502.3]</p> <p>Note: Two spaces may share an access aisle. Check state/local requirements; some specify that each space have its own aisle.</p>	<p>Yes</p> <p>Measurement:</p>	 <p>← 8' min → 5' min →</p>	Photo #:	
<p>1.5 Is the van accessible space:</p> <p>At least 11 feet wide with an access aisle at least 5 feet wide? Or At least 8 feet wide with an access aisle at least 8 feet wide? [502.2]</p>	<p>No</p> <p>Measurement:</p> <p>No</p> <p>Measurement:</p>	 <p>← 11' min → 5' min → or ← 8' min → 8' min →</p>	Photo #:	<ul style="list-style-type: none"> • Reconfigure to provide van-accessible space(s) • Re paint the lines <p>Budget Year: 2021 Cost: \$500</p>
<p>1.7 Are the access aisles marked so as to discourage parking in them? [502.3.3]</p> <p>Note: The marking method and color may be addressed by state/local requirements.</p>	<p>Yes</p>	 <p>area to be marked</p>	Photo #:	

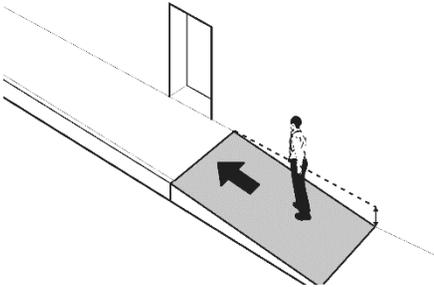
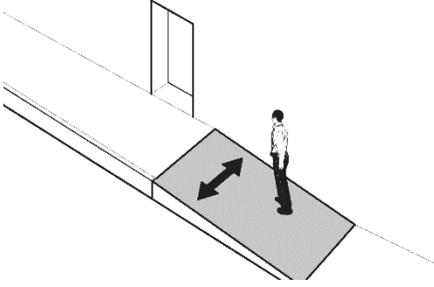
<p>1.8 Is the slope of the accessible parking spaces and access aisles no steeper than 1:48 in all directions? [502.4]</p>	<p>Yes Measurement:</p>		<p>Photo #:</p>	
<p>1.9 Do the access aisles adjoin an accessible route? [502.3]</p>	<p>Yes</p>		<p>Photo #:</p>	
<p>1.10 Are accessible spaces identified with a sign that includes the International Symbol of Accessibility? Is the bottom of the sign at least 60 inches above the ground? [502.6]</p> <p>Note: The International Symbol of Accessibility is not required on the ground.</p>	<p>No NA Measurement:</p>		<p>Photo #:</p>	<ul style="list-style-type: none"> • Install signs <p>Budget Year: 2020</p> <p>Cost: \$100</p>
<p>1.11 Are there signs reading “van accessible” at van accessible spaces? [502.6]</p>	<p>No</p>		<p>Photo #:</p>	<ul style="list-style-type: none"> • Install signs <p>Budget Year: 2020</p> <p>Cost: \$100</p>

<p>1.12 Of the total parking spaces, are the accessible spaces located on the closest accessible route to the accessible entrance(s)? [208.3.1]</p> <p>Note: If parking serves multiple entrances, accessible parking should be dispersed.</p>	<p>Yes</p>		<p>Photo #:</p>	
---	------------	--	-----------------	--

Exterior Accessible Route

<p>1.13 Is the route stable, firm and slip-resistant? [302.1]</p>	<p>Yes</p>		<p>Photo #:</p>	
--	------------	--	-----------------	--

<p>1.14 Is the route at least 36 inches wide? [403.5.1]</p> <p>Note: The accessible route can narrow to 32 inches min. for a max. of 24 inches. These narrower portions of the route must be at least 48 inches from each other.</p>	<p>Yes</p> <p>Measurement:</p>		<p>Photo #:</p>	
---	--------------------------------	---	-----------------	--

<p>1.17 Is the running slope no steeper than 1:20, i.e. for every inch of height change there are at least 20 inches of route run? [403.3]</p> <p>Note: If the running slope is steeper than 1:20, treat as a ramp and add features such as edge protection and handrails.</p>	<p>Yes</p> <p>Measurement:</p>		<p>Photo #:</p>	
<p>1.18 Is the cross slope no steeper than 1:48? [403.3]</p>	<p>Yes</p> <p>Measurement:</p>		<p>Photo #:</p>	

Entrance				
<p>1.37 Is the main entrance accessible?</p>	<p>Yes</p>		<p>Photo #:</p>	

Seating: At dining surfaces (restaurants, cafeterias, bars, etc.) and non-employee work surfaces (libraries, conference rooms, etc.)

Are at least 5%, but no fewer than one, of seating and standing spaces accessible for people who use wheelchairs? [226.1]

No
 Total #:
 Wheelchair #: 0



- Provide accessible picnic tables
- Clean bird droppings out of pavilion

Budget Year: 2021

Cost: \$1,000

Photo #:

Is there a route at least 36 inches wide to accessible seating? [403.5.1]

Yes
 Measurement:



-

Photo #:

