

**Hardin Park
Optimist Field**

602 Crescent Street

Town Administrator Todd Smith

Assessment October 23, 2018



LOCATION SUMMARY

A sixty-five acre park that features an Olympic-sized swimming pool with attached bathhouse, 2 playgrounds, fishing pond, 6 covered pavilions, picnic tables, 3 baseball fields, 2 softball fields, 4 tennis courts, outdoor basketball court, a skatepark, and a walking track/trail. The park also houses the maintenance shop and staff. The maintenance area is comprised of two office buildings, 2 garages, and a storage facility.

Responsible for Hardin Park ADA Transition Plan Section

Director Butch Patterson – 423-638-3143 / bpatterson@greenevilletn.gov

Office Manager/Program Supervisor Lisa Scott Fisher – 423-638-3143 / lfisher@greenevilletn.gov

Maintenance Director John Darnell – 423-823-0720 / jdarnell@greenevilletn.gov

ADA Checklist for Existing Facilities

Based on the 2010 ADA Standards for Accessible Design



Project: ADA Assessment Greenville TN

Building: Hardin Park Optimist Field

Location: 602 Crescent drive

Date: Oct 2, 2018

Surveyors: Dave Wright, Gail Stacy, Caroline Miller

Contact Information: 423-525-5093

Priority 1 – Approach & Entrance

Comments

Possible Solutions

1.1 Is there at least one route from site arrival points (parking, passenger loading zones, public sidewalks and public transportation stops) that does not require the use of stairs? [See 2010 ADA Standards for Accessible Design – 206.2.1]

Yes

If yes, location of route:

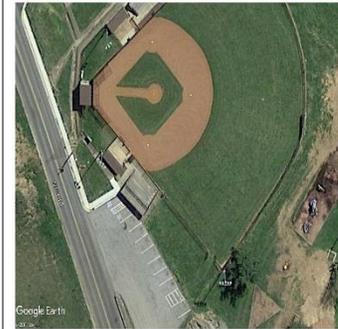


Photo #:

Parking Accessible parking spaces should be identified by size, access aisle and signage.

1.2 If parking is provided for the public, are an adequate number of accessible spaces provided? [208.2]

Yes

Total #: 10

Accessible #: 2

Total Spaces	Accessible Spaces
1 - 25	1
26 - 50	2
51 - 75	3
76 - 100	4
100+ see 2010 Standards 208.2	

Photo #:

1.3 Of the accessible spaces, is at least one a van accessible space?*[208.2.4]

No

*For every 6 or fraction of 6 parking spaces required by the table above, at least 1 should be a van accessible space.

Photo #:

* If constructed before 3/15/2012, parking is compliant if at least 1 in every 8 accessible spaces is van accessible

- Reconfigure by repainting lines

Budget Year: 2020

Cost: \$250

1.4 Are accessible spaces at least 8 feet wide with an access aisle at least 5 feet wide?
[502.2, 502.3]

Note: Two spaces may share an access aisle. Check state/local requirements; some specify that each space have its own aisle.

Yes
Measurement:

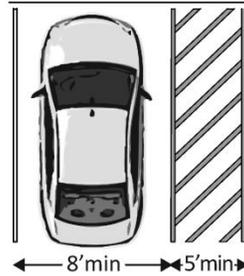


Photo #:

1.7 Are the access aisles marked so as to discourage parking in them?
[502.3.3]

Note: The marking method and color may be addressed by state/local requirements.

Yes

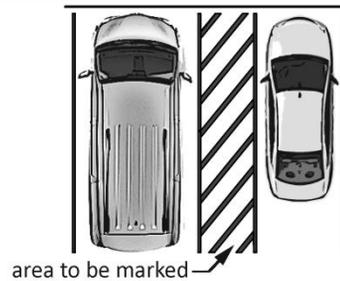
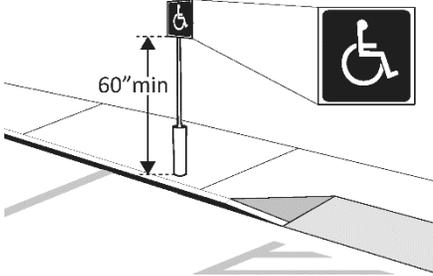


Photo #:

1.8 Is the slope of the accessible parking spaces and access aisles no steeper than 1:48 in all directions?
[502.4]


Yes
Measurement:
1/4" per foot

			Photo #:	
<p>1.9 Do the access aisles adjoin an accessible route? [502.3]</p>	No			<ul style="list-style-type: none"> • Create accessible route • Relocate accessible space • Do sidewalk work to be able to complete <p>Budget Year: 2023</p> <p>Cost: \$7,500</p> <p>Also See 1.30</p>
<p>1.10 Are accessible spaces identified with a sign that includes the International Symbol of Accessibility? Is the bottom of the sign at least 60 inches above the ground? [502.6]</p> <p>Note: The International Symbol of Accessibility is not required on the ground.</p>	No NA Measurement:		Photo #:	<ul style="list-style-type: none"> • Install signs <p>Budget Year: 2020</p> <p>Cost: \$100</p>
			Photo #:	

<p>1.11 Are there signs reading “van accessible” at van accessible spaces? [502.6]</p>	<p>No</p>		<p>Photo #:</p>	<ul style="list-style-type: none"> • Install signs <p>Budget Year: 2020</p> <p>Cost; \$100</p>
<p>1.12 Of the total parking spaces, are the accessible spaces located on the closest accessible route to the accessible entrance(s)? [208.3.1]</p> <p>Note: If parking serves multiple entrances, accessible parking should be dispersed.</p>	<p>Yes</p>		<p>Photo #:</p>	
<p>Exterior Accessible Route</p>				
<p>1.13 Is the route stable, firm and slip-resistant? [302.1]</p>	<p>Yes</p>		<p>Photo #:</p>	

1.14 Is the route at least 36 inches wide?
[403.5.1]

Yes
Measurement:

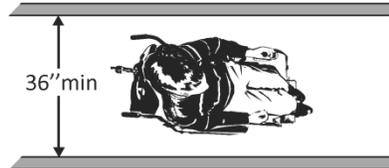

Note: The accessible route can narrow to 32 inches min. for a max. of 24 inches. These narrower portions of the route must be at least 48 inches from each other.

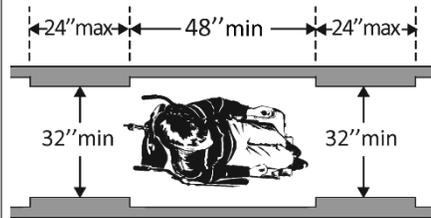
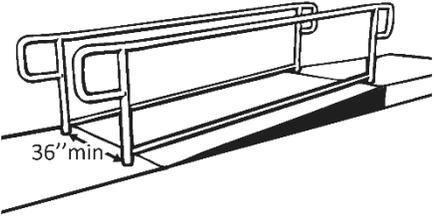
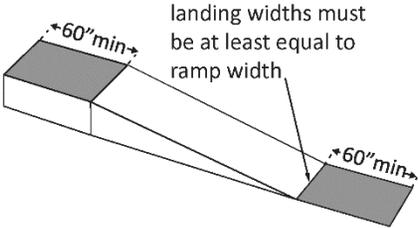
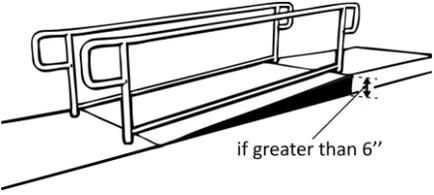


Photo #:



Ramps If any portion of the accessible route is steeper than 1:20, it should be treated as a ramp. From parking - Bleachers to left of press box only

<p>1.25 If there is a ramp is it at least 36 inches wide? [405.5]</p> <p>Note: If there are handrails, measure between the handrails.</p>	<p>Yes</p> <p>Measurement:</p>		<p>Photo #:</p>	
<p>1.26 Is the surface stable, firm and slip resistant? [405.4]</p>	<p>Yes</p>		<p>Photo #:</p>	
<p>1.27 For each section of the ramp, is the running slope no greater than 1:12, i.e. for every inch of height change there are at least 12 inches of ramp run? [405.2]</p> <p>Note: Rises no greater than 3 inches with a slope no steeper than 1:8 and rises no greater than 6 inches with a slope no steeper than 1:10 are permitted when such slopes are necessary due to space limitations.</p>	<p>Yes</p> <p>Measurement:</p>		<p>Photo #:</p>	
<p>1.28 Is there a level landing that is at least 60 inches long and at least as wide as the ramp: At the top of the ramp?</p>	<p>Yes</p> <p>Measurement:</p>		<p>Photo #:</p>	

<p>At the bottom of the ramp? [405.7.2, 405.7.3]</p>	<p>Yes Measurement:</p>		<p>Photo #:</p>	
<p>1.30 If the ramp has a rise higher than 6 inches, are there handrails on both sides? [405.8]</p> <p>Note: Curb ramps are not required to have handrails.</p>	<p>No Measurement:</p>		<p>Photo #:</p>	<ul style="list-style-type: none"> • Add handrails <p>Budget Year: 2023</p> <p>Refer to 1.9 cost included</p>

Entrance				
<p>1.37 Is the main entrance accessible?</p>	<p>Yes</p>		<p>Photo #:</p>	

Sales & Service Counters – banks, stores, dry cleaners, auto repair shops, fitness clubs, etc.
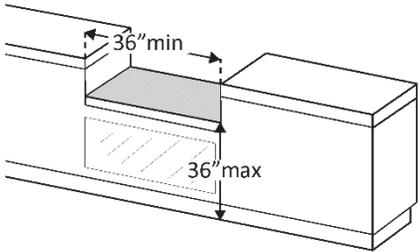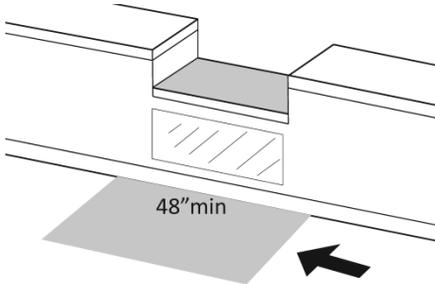
<p>2.76 Is there a portion of at least one of each type of counter that is:</p> <p>No higher than 36 inches above the floor?</p> <p>At least 36 inches long? [904.4.1]</p>	<p>No Measurement: 42"</p> <p>Yes Measurement: 48"</p>		 <p>Photo #:</p>	<ul style="list-style-type: none"> • Lower section of counter • Add roll up door to match <p>Budget Year: 2024</p> <p>Cost: \$750</p>
<p>2.79 For a parallel approach, is the clear floor space positioned with the 48 inches adjacent to the accessible length of counter? [904.4.1]</p>	<p>Yes</p> <p>Too much slope at counter</p>		<p>Photo #:</p>	<ul style="list-style-type: none"> • If a parallel approach is not possible, a forward approach is required • •

